

# **DPI610E series**

## **Druck Hand-held pressure calibrator**

The DPI610E handheld pressure calibrator is the latest and the sixth generation of the DPI600 family.

The DPI610E combines effortless pressure measurement and generation, signal measurement and loop power with significantly improved pump capabilities and a powerful touch and button user interface.

With a robust design, the unit has been engineered for instrument technicians, using input from those working in the field. It is an ideal solution to your test and calibration application.

### Features

- The complete pressure calibration tool provides pressure:
  - o Vacuum to 35 bar/500 psi/3.5 MPa pneumatic pressures with inbuilt barometer for accurate pseudo pressure measurements
  - o Up to 1000 bar/15000 psi/100 MPa hydraulic pressures
- · HART as standard on all versions
- Best in class pressure accuracy: Total 1 year uncertainty down to 0.025% full scale (FS) over temperature range of -10°C to +50°C
- · Integral calibration record with calibration due countdown
- Robust, handheld design with backlit high-contrast display
- · Hazardous area (Intrinsically safe) version available
- Optional remote plug and play pressure sensor (PM700E) and Resistance Temperature Detector (RTD-INTERFACE)
- Minimise in-the-field leaks with quick-fit pressure adapters and hoses
- Full data logging and local documenting capabilities included



## DPI610E hand-held pressure calibrator

The DPI610E is the sixth generation in the DPI600 family, which was first introduced in 1984. The DPI600 family revolutionized test and calibration by providing all the tools for pressure generation and signal measurement in selfcontained portable packages. The DPI600 soon became the industry workhorse and today it is simply known as the "Druck."

Building on the technical legacy and more than three decades of experience in pressure measurement and calibration, the DPI610E provides all the convenience and reliability of a true "Druck", yet offers faster performance with optional hazardous area approvals.

## **Pressure accuracy**

By continuing to use Druck's in-house sensor technology, the DPI610E provides highly accurate, reliable, and stable pressure measurement. Total 1 year uncertainty down to 0.025% Full Scale (FS) over temperature range of -10°C to +50°C gives you complete confidence in the measurement accuracy between annual calibrations.

## **Precision engineering**

## Performance is a function of precision engineering

The choice of case material and precision over molding ensures that the DPI610E is rugged, weatherproof, and suitable for the harshest environments.

The DPI610E retains the comprehensive electrical measurement and sourcing capability of the original DPI610E series, but has better accuracy and simplified connections.

The integrated pressure pump along with internal and optional external pressure measurement sensors work seamlessly with the electrical sourcing and measurement functions to provide a one-stop calibration instrument.

#### **Pressure connection**

The DPI610E provides a tool-less quick-fit connection where finger-tight connections achieve pressure-tight connections at up to 1000 bar. Supplied with a 1m quick-fit hose and G1/8 female and 1/8 NPT female adapters. Other adapters available, see accessories.



#### Designed for real-world use

The ergonomic handle design provides you with a secure grip for use against a wall or hand-held use to prevent the instrument from sliding when on a bench. A built-in hand/ shoulder strap enables easy portability in the field.



## **Pressure generation**

The innovative design of the DPI610E pressure generation system provides significantly easier and more efficient pressure generation and precise control using carefully selected components.

With the improved pressure generation capabilities, the DPI610E provides higher pressures and higher volume handling with market leading pneumatic pressures from 95% vacuum to 35 bar/500 psi/3.5 MPa. A simple selector lets you switch from vacuum to pressure and with a few stokes of the pump, you can generate the required pressure. Fine adjustment can be made with the built-in volume adjuster and falling pressure calibration points are achieved with the precision-control vent valve.

#### **Pneumatic Version**

The pneumatic version has a supplied dirt trap to prevent contamination of both the instrument itself and the system under test from dirt and debris as well as moisture.

Pneumatic pressure generation range is -0.95 to 35 bar/ 500 psi/3.5 Mpa (gauge).

An internal Pressure Relief Valve vents safely inside the case to protect the internal pressure sensor. The relief pressure is factory set to be appropriate to the sensor/pressure range ordered.

#### **Hydraulic Version**

The hydraulic version has an external 100cc reservoir for easy visibility of hydraulic oil or water, a priming pump to expel air from the connected system and an intensifier to quickly and easily generate pressure up to 1000 bar/15000 psi/100 MPa.

- Hydraulic pressure generation range is up to 1000 bar/15000 psi/ 100 Mpa (absolute).
- An internal Pressure Relief Valve vents safely back to the reservoir to protect the internal pressure sensor. The relief pressure is factory set to be appropriate to the sensor/ pressure range ordered.



#### **Zero Correction**

Zero pressure correction is available for gauge/differential sensors.

#### Pressure units

Work in whatever pressure units suit you and your application: mbar, bar, Pa(N/m<sup>2</sup>), hPa, kPa, MPa, mmHg@0°C, cmHg@0°C, mHg0°C, inHg@0°C, kg/cm<sup>2</sup>, kg/m<sup>2</sup>, mmH<sub>2</sub>O@20°C, cmH<sub>2</sub>O@20°C, mH<sub>2</sub>O@20°C, torr, atm, psi, lb/ft<sup>2</sup>, inH<sub>2</sub>O@4°C, inH<sub>2</sub>O@20°C, inH<sub>2</sub>O@60°F, ftH<sub>2</sub>O@20°C, ftH<sub>2</sub>O@4°C, ftH<sub>2</sub>O@60°F, mmH<sub>2</sub>O@4°C, cmH<sub>2</sub>O@4°C, mH<sub>2</sub>O@4°C, custom (user defined)

#### Pressure sensor modes

On Pneumatic versions, an internal barometer is fitted which allows both gauge and absolute pressure sensors to be used in pseudo-ranges

On Hydraulic versions, we offer the sealed gauge measurement mode on absolute pressure sensors (10 bar and above)

## **Pressure Measurement Utilities**

All utility test results can be saved and exported to a PC.

#### Leak test

Used to determine if there is a leak in the system by recording the pressure change over a fixed period of time.

Leak test can also be used with the RTD sensor to record a temperature change over time.


User defined settling/wait (up to 60 minutes)and test periods (1 second to 480 minutes) with live countdown timer.

#### **Relief valve**

Used to test whether safety relief or blowdown valves meet the required safe pressure release action when outside the safe pressure limits and return to normal closed position when returned normal operating pressure limits.

#### **Switch Test**

This feature tests the actuation of pressure switches when they reach their set trip points and the reset action when the pressure returns to normal operating pressure limits. The Hysteresis value is also calculated at the end of each test.

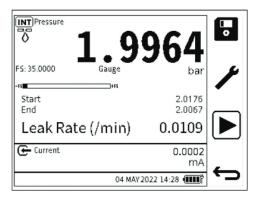

## **DPI610E external features**


#### Hazardous area pneumatic unit shown



## Brand new User Interface

The DPI610E user interface can be fully driven from either the touchscreen or via push buttons to allow use with or without gloves.


- The DASHBOARD allows quick application selection without the need for menus or special keys.
- The TASK menu provides a library of popular configurations. From the dashboard screen three clicks completely reconfigure the DPI610E for the next job.
- From the FAVORITES menu it's even quicker to access regularly used and customized TASKS.
- Electrical connection diagrams can be viewed on screen.

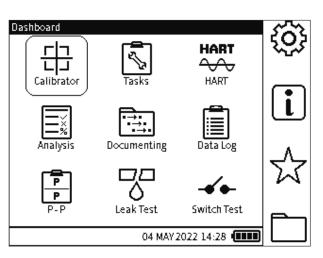


Dashboard (Home) Screen

## Intuitive simple user interface


1. Select the Tasks from the Dashboard

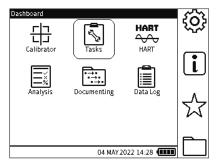

2. Touch to a TASK to make a selection

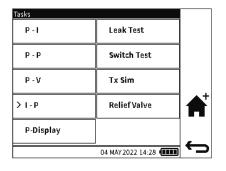


3 Touch again to set up the TASK

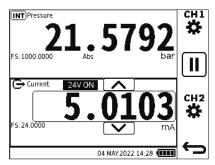

## Multiple parameter display capability


The display can be configured to show up to four simultaneous measurement readings in the channel windows.

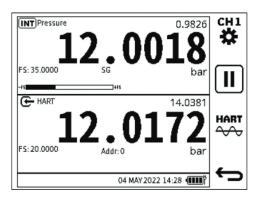

## Instrument features


**Current Source Automation (mA Output):** Simply configured for simulating transmitter outputs into control loops, testing valve positioners and checking safety systems. The source function has programmable end points, with manual or automatic sequencing. The following options are available for quick set-up:

• % step: The step size is defined as a percentage between two end points. For example, 25% between 4 and 20 mA provides five test points of 4, 8, 12, 16 and 20 mA.

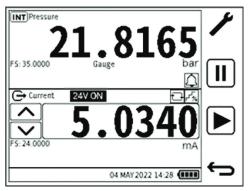

25% step manual advance

- Defined step: The step size is defined as a value in mA.
- **Span check:** Toggles between two end points, for example, 4 and 20 mA for checking zero and FS.
- Ramp: A linear ramp between two end points with programmable travel and dwell times is perfect for dynamically testing switches.

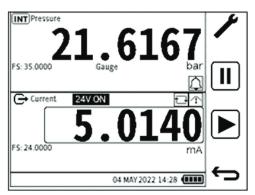


RAMP automatic cycle

**Nudge:** Simply used to make a small incremental change to a mA output using up/down keys. This is great for determining trip values.

**Help:** The DPI610E is provided with a multi-lingual quick user guide to get you up and running without delay. For convenience, the full manual is stored digitally within the instrument and can be transferred to a PC for viewing or printing.

In the Help Application, context related hints and tips can be accessed as well as any relevant electrical connection diagrams.

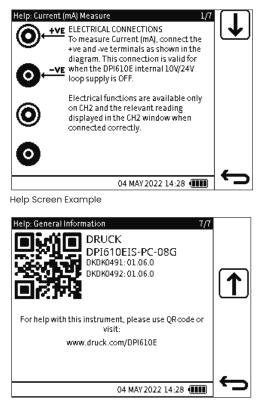

Product Information and QR code for full user manual

### **Measurement Resolution**

**Pressure Resolution:** Adjustable from four to seven digits; this matches the displayed value to that of the test device for easy comparison.

**Electrical Resolution:** voltage measurement is adjustable from four to seven digits, current measurement and sourcing from four to six digits.

## **Measurement Process Options**

#### Tare

0 to 100% FS temporary zero offset capability by subtracting the current reading from subsequent measurements. Can be applied to all measurement types.

#### **Filter**

Enables a filtered reading by showing a rolling average of the last 10 measurements. Provides a more stable reading in a noisy measurement. Can be applied to all measurement types.

#### Alarm

User adjustable alarms with visual (bell icon, pressure reading and backlight flash). Can be applied to all measurement types.

#### Flow


Performs a square root calculation on the measured pressure reading.


#### Scaling

Allows measured values to be scaled to user defined custom units with custom unit labels. For example, mA expressed as a %. Flow correction is available for scaling differential flow transmitter outputs.

#### Min/Max/Mean

Provides instantaneous minimum, maximum, and average values of any measurement type to be captured and displayed.

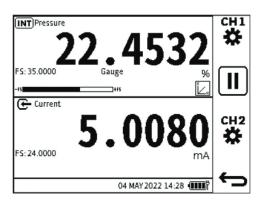

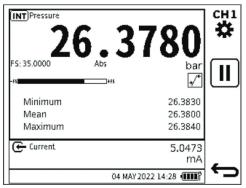

## Documenting

The DPI610E is a simple-to-use "everyday" tool for maintaining and calibrating pressure instruments. It has a documenting application, providing advanced features for automating calibration procedures, calculating errors and interfacing with PCs and calibration and maintenance systems.

#### **Automated calibration procedures**

Test procedures can be created using the DPI610E. These procedures are presented as a list of work orders and when selected, each one will configure the DPI610E to calibrate a specific device.

The procedures run automatically and all you have to do is set the pressure. The data is recorded digitally ready to be uploaded to a database or calibration management software.

A single test procedure template can be run on multiple assets with results for each asset saved individually in the internal storage of the DPI610E and can be transferred to a PC to support traceability.

When the test results are exported to a PC, Druck provides a Calibration Certificate Wizard which transforms the results into a formatted professional-look certificate ready for printing or filing.

Using the DPI610E with semi-automated procedures significantly reduces the time taken to calibrate a device, from typically 40 minutes to less than 10 minutes including the time to set-up. Further time is saved when accessing the data and creating calibration reports because these operations are automated within the software.

DEVICE UNDER TEST				1	CALIBRATION		
Device Identifier	_	PTX501			Date of Calibration	01 JUN 2022	
Serial Number		112233			Operator	Tech01	
Manufacturer		Druck			Location	Global Star Lab	
Model		PTX Series			Ambient Temperature	20.00 °C	
Sensor Type		Gauge			Ambient Pressure	1001.28 mbar	
Range		0 to 1 bar		l l	Ambient Humidity	70%	
			TES	EQUIPMENT			
		MAIN CALIBRATOR			ADDITIONAL SENSO	RS	
Manufacturer Model		Druck DPI610E-PC-14G		Manufacturer Model	Druck PM700E		
Model Serial Number		98765		Model Serial Number	12222043		
Date of Calibration		30 JAN 2022		Date of Calibration	02 MAR 2022		
Sensor Type		Gauge		Sensor Type	Gauge		
Sensor Range		-1.00 to 20.00 bar		Sensor Range	-1.00 to 35.00 bar		
		RANGE			TOLERANCE		
Input		0.00000 to 1.00000 bar		Test Point		5.00% Span	
Output		4.0000 to 20.0000 mA		Pass / Fail		0.10% Span	
Relationship		Linear		Adjustment		0.07% Span	
	Þ	CH1 Pressure (INT) mber	CH1 Pressure (INT) mber	CH2 Current (Measure) mA	CH2 Current (Measure) mA	mA	
	1		mber 0.003	mA 4.000	mA 4.001	mA 0.030	PASS
	2		199.880	7,200	7,206	0.021	PASS
	3	400.000	400.011	10.400	10.396	0.012	PASS
	4		600.260	13.600	13.598	0.014	PASS
	5		500.039 1000.047	16.800	16.807	0.011	PASS
	6		1000.047	20.000	20.026	0.010	PASS
	- 7		600.075	13.600	16.506	0.015	PASS
			400.051	10.400	10 399	0.017	PASS
	10	200.000	199.982	7.200	7.207	0.009	PASS
	11		-0.002	4.000	4.006	0.011	PASS
	12						
	13						
	14						
	16						
	17						
	18						
	19						
	20						
	21						
	22						
	24 25						

Sample of Certificate from Calibration Certificate Wizard

#### PASS/FAIL error analysis

Error analysis calculates the error of the device being tested and reports a pass or fail. The error is displayed live allowing zero and span adjustments to be assessed as they are made.

## Datalogging

#### Multi-channel data logging

The DPI610E can record data from 2 channels simultaneously by manually touching a record button or automatically at a user set interval. Data can be reviewed on screen or the data file can be transferred to a PC for further analysis.

The DPI610E can hold over 100,000 datalog points.

## **Specifications**

#### **Pneumatic pressure**

		(1 Year	certainty ) (%FS) 50 °C	
	Pressure range	NLHR (24hr) (% FS)' -10 to 50 °C	Gauge -10 to 50 °C	Pseudo Abs (1) 0 to 50 °C
03G	350 mbar/5 psi/35 kPa	0.02	0.047	0.186
05G	1 bar/15 psi/100 kPa	0.0185	0.044	0.077
07G	2 bar/30 psi/200 kPa	0.018	0.025	0.040
08G	3.5 bar/50 psi/350 kPa	0.018	0.025	0.031
10G	7 bar/100 psi/700 kPa	0.018	0.025	0.027
11G	10 bar/150 psi/1000 kPa	0.018	0.025	0.026
13G	20 bar/300 psi/2 MPa	0.018	0.025	0.025
14G	35 bar/500 psi/3.5 MPa	0.018	0.025	0.025

#### **Hydraulic Pressure**

				Total uncertainty (1 Year) (%FS) -10 to 50 degrees C		
	Pressure range	NLHR (24hr) (% FS) '-10 to 50 °C	Gauge	Abs	Sealed gauge	
16A	70 bar/1000 psi/7 MPa	0.018		0.063	0.025	
16G	70 bar/1000 psi/7 MPa	0.018	0.025			
165A	100 bar/1500 psi/10 MPa	0.018		0.063	0.025	
165G	100 bar/1500 psi/10 MPa	0.018	0.025			
17A	135 bar/2000 psi/13.5 MPa	0.018		0.063	0.025	
17G	135 bar/2000 psi/13.5 MPa	0.018	0.025			
18A	200 bar/3000 psi/20 MPa	0.018		0.063	0.025	
18G	200 bar/3000 psi/20 MPa	0.018	0.025			
20A	350 bar/5000 psi/35 MPa	0.018		0.063	0.025	
22A	700 bar/10000 psi/70 MPa	0.018		0.063	0.025	
23A	1000 bar/15000 psi/100 MPa	0.018		0.063	0.025	

Note 1: Pseudo abs is using a gauge sensor in conjunction with the internal barometer to provide an absolute pressure reading. Total uncertainty figures are %FS of the gauge pressure range. Barometer total uncertainty (24hr) is <0.5mbar, drift is <0.33mbar/year typical.

#### **Electrical measurement and source**

	Total uncertainty 10°C to 30°C (50° to 86°F) for one year %Rdg + %FS		Additional error -10°C to 10°C & 30°C to 50°C %FS/°C	Resolution
Measure mode				
DC				
+/- 200 mV	0.018	0.005	0.001	0.001
+/- 2000 mV	0.018	0.005	0.001	0.01
+/- 20 V	0.018	0.005	0.001	0.00001
+/- 30 V	0.018 0.005		0.001	0.0001
Current				
+/- 20 mA	0.015	0.006	0.001	0.0001
+/- 55 mA	0.018	0.006	0.001	0.0001
Source mode				
DC				
10V* (Fixed, 25mA max.)	0	0.1	0	0.001
24V (Fixed, 25mA max.)	n/a – loop suppl			ý
Current				
0.6 to 24 mA	0.018	0.006	0.001	0.0001
0.6 to 24 mA (internal loop power)	0.018	0.006	0.001	0.0001

FS = Full scale Rdg = reading \* Non-IS unit only

#### **Pressure media**

Most gases compatible with aluminum, brass, stainless steel, nitrile and polyurethane seals, PTFE, acetal, nylon.

#### **Calibration certificates**

- Electrical calibration certificate supplied
- Pressure calibration certificate supplied in bar, psi and kPa
- Optional UKAS accredited calibration available

## Ordering information

Please use the following part numbers when ordering:

Model type	
DPI610E-PC	Pneumatic safe area
DPI610E-HC	Hydraulic safe area
DPI610E-SPC	Pneumatic hazardous area
DPI610E-SHC	Hydraulic hazardous area

#### Pressure range code and reference type (Gauge or Absolute);

(Mandatory to select only one e.g. 16G for each configuration)

	Pressure range code	Pneumatic DPI610E- PC, DPI610E-SPC	Hydraulic DPI610E HC, DPI610E-SHC
350 mbar/5 psi/35 kPa	03	G	_
1 bar/15 psi/100 kPa	05	G	_
2 bar/30 psi/200 kPa	07	G	-
3.5 bar/50 psi/350 kPa	08	G	-
7 bar/100 psi/700 kPa	10	G	-
10 bar/150 psi/1000 kPa	11	G	-
20 bar/300 psi/2 MPa	13	G	-
35 bar/500 psi/3.5 MPa	14	G	-
70 bar/1000 psi/7 MPa	16	-	G or A
100 bar/1500 psi/10 MPa	165	-	G or A
135 bar/2000 psi/13.5 MPa	17	-	G or A
200 bar/3000 psi/20 MPa	18	-	G or A
350 bar/5000 psi/35 MPa	20	-	А
700 bar/10000 psi/70 MPa	22	-	А
1000 bar/15000 psi/100 MPa	23	-	А
Pressure units			
<b>U0</b> All pressure units (Defa	ult selection)		
<b>U1</b> Pa (Si) pressure units of	nly		
Country of use (entered d	uring order process to ensure r	elevant approvals are availc	able for Bluetooth featur
Bluetooth required			
B0 Bluetooth not r	equired		
Options			
M 1m Hose			

DPI610E-PC -03G -UO B0 -M (Example part number)

UKAS calibration is available - please order as separate line item.

Each DPI 610E is supplied with a lithium ion battery, mains charger, integrated carry strap, test leads, G1/8 female and 1/8 NPT female adaptors, calibration certificate, quick start user guide. All pneumatic versions come with an IDT dirt moisture trap to prevent contamination and all hydraulic versions come with a 100ml reservoir.

General specifications				
Display	Size: 112mm (4.4in) diagonal. 320 x 240 pixels. LCD monochrome display			
Internal memory	100,000 point data logging memory, store user procedures and test results			
Languages	English, Chinese, Dutch, French, German, Italian, Japanese, Korean, Portuguese, Spanish, Turkish, Polish			
Operating temperature	-10° to 50°C (14° to 122°F)			
Storage temperature	-20° to 70°C (-4° to 158°F)			
Ingress protection	IP 54. Protected against dust and splashing water from any direction			
Humidity	0 to 90% RH non-condensing. To Def Stan 66-31, 8.6 cat III			
Shock/vibration	BS EN 61010-1:2010/MIL-PRF-28800F CLASS 2			
Altitude	Up to 2000m			
EMC	BS EN 61326-1:2013			
Electrical safety	BS EN 61010-1:2010			
Pressure safety	Pressure Equipment Directive - Class: Sound Engineering Practice (SEP)			

General specifications					
Enclosure materials	PC ABS, Polycarbonate, polyamide, polypropylene, acrylic, cotton (strap)				
Approvals	CE marked, UKCA marked Hazardous Area version: ATEX, IECex, UKEX to EN60079-11:2012 Ex ia IIC T4 Ga (-10 to 50 °C)				
Size (L:W:H)	Pneumatic: 350 x 150 x 180 mm (13.8 x 5.9 x 7.1 in) Hydraulic: 400 x 150 x 190 mm ( 15.7 x 5.9 x 7.5 in)				
WeightPneumatic - 3.6Kg (8 lbs) including batteryHydraulic - 4.4Kg (10 lbs) including battery					
Power supply	Integral Lithium ion battery Mains adaptor P/N 10610E-PSU 100 – 260V 50/60Hz AC, Output DC V=15V, 1.6A				
Battery life	<ul> <li>Much improved battery performance typically:</li> <li>100% Volts Measure, 0% Current Source 4mA, 0% Current Source 20mA -&gt; 90 hours</li> <li>80% Volts Measure, 10% Current Source 4mA, 10% Current Source 20mA -&gt; 74.8 hours</li> <li>40% Volts Measure, 40% Current Source 4mA, 20% Current Source 20mA -&gt; 62 hours</li> <li>0% Volts Measure, 0% Current Source 4mA, 100% Current Source 20mA -&gt; 31.5 hours</li> <li>Full recharge in 2 hours with supplied charger</li> </ul>				
Connectivity	USB client micro-USB				

### Plug and play remote sensor range



#### PM 700E External remote pressure sensors

Any number of remote sensors can be individually used with a single DPI610E as all sensors hold their own calibration data and are supplied with a 2.9m (9.5 feet) cable.


Available ranges as per table:

	PM 700E External	pressure sensor ava	ilability
Туре	Standard Accuracy 0.1% (-1)	High Accuracy 0.05% (-2)	Premium Accuracy 0.025% (-3)
25 mbar / 10 inH2O / 2.5 kPa	G, L	-	-
70 mbar / 1 psi / 7 kPa	G, L	-	-
200 mbar / 3 psi / 20 kPa	G, L	-	-
350 mbar / 5 psi / 35 kPa	G, A, L	G, L	-
700 mbar / 10 psi / 70 kPa	G, A, L	G, L	-
1 bar / 15 psi / 100 kPa	G, A, L	G, A, L	-
750-1150 mbar / 11-17 psi /75-115 kPa (Barometric)	В	В	-
2 bar / 30 psi / 200 kPa	G, A, L	G, A, L	G,L
3.5 bar / 50 psi / 350 kPa	G, A	G, A	G
7 bar / 100 psi / 700 kPa	G, A	G, A	G
10 bar / 150 psi / 1000 kPa	G, A	G, A	G, A
20 bar / 300 psi / 2 MPa	G, A	G, A	G, A
35 bar / 500 psi / 3.5 MPa	G, A	G, A	G, A
70 bar / 1000 psi / 7 MPa	G, A	G, A	G, A
100 bar / 1500 psi / 10 MPa	G, A	G, A	G, A
135 bar / 2000 psi / 13.5 MPa	G, A	G, A	G, A
200 bar / 3000 psi / 20 MPa	G, A	G, A	G, A
350 bar / 5000 psi / 35 MPa	А	А	А
700 bar / 10000 psi / 70 MPa	А	А	А
1000 bar/ 15000 psi/ 100 MPa	А	А	А
1400 bar / 20000 psi / 140 MPa	А	А	А
G = Gauge L = Differential	A = A	bsolute	B = Baro

### Negative calibration option (OP1) (Gauge sensors)

Full Scale Pressure Range	Standard and High Accuracy sensors	Premium accuracy sensors
25 mbar to 1 bar/10 inH2O to 15 psi/100 kPa to 2.5 kPa	Available down to negative Full Scale by default	Not available
1 bar to 20 bar/15 psi to 300 psi/20 kPa to 2 MPa	Available down to -1 bar g as option OP1	Available down to -1 barg by default
35 bar to 200 bar/500 psi to 3000 psi/3.5 MPa to 20 MPa	Not available – calibrated down to 0 bar g	Not available – calibrated down to 0 bar g

Note: All differentials calibrated down to negative Full Scale (limited to -1bar)

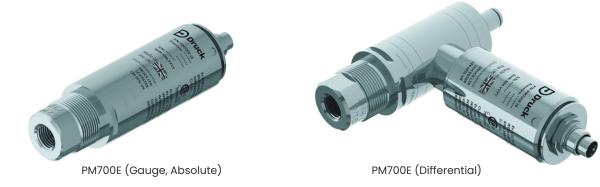

#### PM 700E External remote pressure sensors

#### **Accuracy levels**

1-Standard	±0.1% FS Total accuracy over -10 to 50 °C including NLH&R,1 year drift and calibration uncertainty
2-High	±0.05% FS Total accuracy over -10 to 50 °C including NLH&R,1 year drift and calibration uncertainty
3-Premium	±0.025% FS Total accuracy over -10 to 50 °C including NLH&R,1 year drift and calibration uncertainty

#### **Accuracy specification**

Gauge/differential sensors	Standa	rd accuracy	High accuracy Pro		Premiu	nium accuracy	
	NLH&R	Total uncertainty	NLH&R	Total uncertainty	NLH&R	Total uncertainty	
Pressure range	-10 to 50°C (14 to 122°F)						
_	(% FS)	(% FS)	(% FS)	(% FS)	(% FS)	(% FS)	
25 mbar	0.3	0.348	N/A	N/A	N/A	N/A	
70 mbar	0.1	0.121	N/A	N/A	N/A	N/A	
200 mbar	0.08	0.1	N/A	N/A	N/A	N/A	
350 mbar to 1 bar	0.08	0.1	0.04	0.05	N/A	N/A	
2 bar to 200 bar	0.08	0.1	0.04	0.05	0.018	0.025	

Absolute sensors	Standard accuracy		High accuracy		Premium accuracy		
	NLH&R	Total uncertainty	NLH&R	Total uncertainty	NLH&R	Total uncertainty	
Pressure range	-10 to 50°C (14 to 122°F)						
	(% FS)	(% FS)	(% FS)	(% FS)	(% FS)	(% FS)	
750 - 1150 mbar (Barometric)	0.08	0.1	0.04	0.075	N/A	N/A	
350 mbar and 700 mbar	0.08	0.1	N/A	N/A	N/A	N/A	
1 bar to 7 bar	0.08	0.1	0.04	0.075	N/A	N/A	
10 bar to 1400 bar	0.08	0.1	0.04	0.075	0.018	0.063	

Notes:

1. NLH&R Non-linearity, hysteresis and repeatability.

2. Total uncertainty includes I year drift and calibration uncertainty. For 350mbar to 7bar absolute ranges typical values are stated – for maximum values add 0.045%FS for standard accuracy, 0.055%FS for high accuracy. For 10bar absolute ranges and above maximum values are stated above.

#### Media compatibility

Sensors up to and including 3.5bar (including differential) are exposed, 7-1400bar are diaphragm isolated.

Media compatibility	
Non-condensing dry gases compatible with 316L Stainless Steel, Pyrex, Silicon, Gold, Aluminium, Glass, Silicon Dioxide and RTV Adhesive	
Non-condensing dry gases compatible with 316L and 304 Stainless Steel, Pyrex, Silicon, Glass, Silicon Dioxide and RTV Adhesive.	
316L Stainless Steel and Hastelloy C276	
Inconel 625 and 17-4PH Stainless Steel	

### **Pressure fittings**

Remote sensors are fitted with pressure connectors as detailed below:

- P1 G1/8 Female direct sensor connection of instrument, welded non-removable (for ranges 200 bar and below) with optional adaptor:
- P2 G1/4 Female adaptor that goes into the instruments G1/8 female
- P3 1/8 NPT Female adaptor that goes into the instruments G1/8 female
- P4 1/4 NPT Female adaptor that goes into the instruments G1/8 female
- P5 Quick-Fit adaptor comes with G1/8 and 1/8 NPT adaptors
- P6 9/16 x 18 UNF Male direct sensor connection of instrument, welded non-removable (mandatory for ranges greater than/equal to 350 bar)

Note: Only fluids that are compatible as per above table should be used, to ensure the integrity of the pressure sensor.


## Optional remote RTD temperature interface/probe

Enabling users to perform plug and play temperature measurement capability, displaying units as resistance or temperature.

The Interface only option P/N RTD-INTERFACE-485 for DPI610E-PC / DPI610E-HC Safe Area or P/N RTD-INTERFACE-IS for DPI610E-SPC / DPI610E-SHC Hazardous Area allows users to use their own PT100 RTD probe.

RTD-INTERFACE is supplied with a field-rewireable M12 connector to allow users to connect their own wire-ended RTDs.

The probe option P/N RTD-PROBE-485 for DPI610E-PC / DPI610E-HC Safe Area or P/N RTD-PROBE-IS for DPI610E-SPC / DPI610E-SHC Hazardous Area comes with the interface and a 15 cm (6") class A PT100 probe. All RTD-PROBE and RTD-INTERFACE come with a 2.9m cable.



	NLH&R ±1°C (2°F) for 24 hrs (note 1)	Total Uncertainty 10° to 30°C (50° to 86°F) for 1 year (note 2)	Additional error -10° to 10°C (14° to 50°F) 30° to 50°C (86° to 122°F)
0 to 400 Ω	0.012% Rdg + 0.005% FS	0.015% Rdg + 0.006% FS	0.001% FS/°C
Pt 100 - Measured temp range -200 to 0°C		0.017% Rdg + 0.1°C	Excluding PT100 calibration error
Pt 100 - Measured temp range 0 to 850°C		0.0215% Rdg + 0.1°C	Excluding PT100 calibration error

Notes:

- 1. NLH&R includes stability at  $\pm 2^{\circ}\text{C}$  for 24 hours, at temperatures within 10°C to 30°C.
- 2. Total uncertainty includes 1 year drift




#### **RTD General specifications**

Measuring temperatures	IO-RTD-PRB150	-50°C to 200°C (when used with appropriate extension cable)	
	RTD-INTERFACE (BODY)	-10°C to 50°C	
		-10°C to 50°C when directly plugged in to RTD-INTERFACE	
	RTD-PROBE	-25°C to 75°C when using supplied cable	
	SPECIALIST RTD PROBES (Not supplied by Druck)	The capability of the RTD-INTERFACE (resistance range) with a suitable extension cable and suitable probe is 0 to $400\Omega$ which equates to $-250^{\circ}$ C to $+650^{\circ}$ C for a PTI00 probe.	
Dimensions	IO-RTD-PRB150 RTD-PROBE	Probe tip: Ø6.35 x 150mm Probe total: Ø15 x 200mm	
	RTD-INTERFACE	Body: Ø34 x 72mm length	

## Ordering information for PM700E external remote pressure sensors

The PM 700E and PM 700E-IS are supplied with a user guide and calibration certificate as standard.

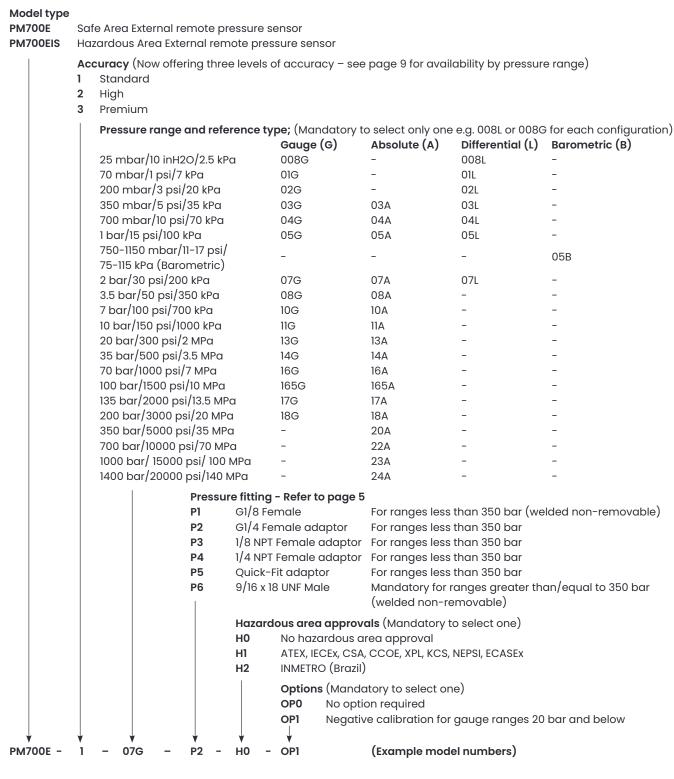

## **PM700E Options**

#### **OP1 - Negative calibration**

Optionally available for Gauge ranges of 20 bar and below (default for -3 accuracy). If this option is chosen, then the calibration certificate will include values down to -1 bar g.

#### **UKAS calibration**

We also offer UKAS accredited calibrations, please advise at the time of order placement if required.

## Accessories

Please order accessories by part number as separate line items:

#### DPI610E carry case (P/N IO610E-CASE)

A hazardous area to Zone 0 tailored carry case made from durable leather. Detachable shoulder strap and storage pocket for test leads, IDT, reservoir, and other items.

#### DPI610E car charger (P/N IO610E-CAR-CHARGER)

A 12V car charger ensures you can charge on the go or remotely from the workshop.

#### USB cable (P/N IO610E-USB-CABLE)

DPI610E USB A-B cable 2m

#### Mains PSU/charger

A universal input mains adapter. Input voltage 100

(P/N IO610E-PSU) (PSU supplied as standard with all DPI610E)



to 240 VAC 50/60 Hz. Mains socket adapters are provided.

## 100cc hydraulic reservoir

(P/N PV411-115) (reservoir supplied as standard with all hydraulic DPI610E)

A 100cc removable hydraulic reservoir which can be disconnected from the DPI610E without draining the fluid

#### 100cc hydraulic reservoir (Ex)

#### (P/N PV411-115-IS)

Hazardous area 100cc removable hydraulic reservoir which can be disconnected from the DPI610E without draining the fluid

## **Dirt moisture trap** (P/N IO620-IDT-621-NEW)



**Dirt moisture trap (Ex)** (P/N IO620-IDT621-IS)

(IDT's supplied as standard with all pneumatic DPI610E)

Prevents contamination of the DPI610E

pneumatic system and cross contamination from one device under test to another. The trap connects directly to the pressure port and replicates the DPI610E quick fit connection for compatibility with the standard adapters,

adapter kits and hoses. IS version is a hazardous area accessory.

#### **Pneumatic hoses**

A pneumatic hose rated to 35 bar (518 psi). The hose connects directly to the DPI610E pressure port and replicates the quick fit

connection for compatibility with the standard adaptors supplied and the adaptor kits. IS version is a hazardous

area accessory.

P/N IOHOSE-NP1: 1m/3.28ft pneumatic hose kit

P/N **IO620-HOSE-P1-IS:** Im/3.28ft pneumatic hose kit Also available as **P2** (2m/6.56ft ) and **P3** (3m/9.84ft) versions

## Pressure adapter sets

A set of test point adaptors to connect the tool-less quick fit DPI610E pressure port or the extension hoses to the device under test



**P/N 10620-BSP:** G1/8 male and G1/4 male, G1/4 female, G3/8 female and G1/2 female

**P/N 10620-NPT:** 1/8" male and 1/4"male, 1/4" female, 3/8" female, and 1/2" female

P/N IO620-MET: 14 mm female and 20 mm female



#### **Hydraulic hoses**

A high pressure hydraulic hose rated to 1,000 bar (15,000 psi) and terminated with quick fit connectors compatible with the test point adapters supplied with the DPI610E and the adapter sets. The hose is self sealing to avoid leakage when disconnected.

P/N IO620-HOSE-H1: 1 m/3.28 ft hydraulic hose

P/N IO620-HOSE-H1-IS: 1 m/3.28 ft hydraulic hose

Also available as **H2** (2m/6.56ft ) and **H3** (3m/9.84ft) versions

#### **Related products**

For information on the wide range of pressure, temperature and electrical test and calibration equipment please visit our web site at Druck.com/Expert.







Copyright 2022 Baker Hughes Company. All rights reserved. 920–698A BHCS39207 (06/2022)